

# Manhole Inspection Summary

## Manhole # S13OO1008MH

Printed On: 12/17/2008

Page 1 of 4

**Inspection** ☐ Is Incomplete Rating: **3) Fair**

Record Plat: **13001** Node: **008** Status: **Found**

Insp Date: **11/29/06 10:26 AM**

Incomplete Comments

Crew: **CH, HDP**  
Inspector: **Hale, C**  
Firm: **RKK**

**Location** Address: **4802 POE AVBE**

Cross Street: **CYLBURN MEADOWS CT**

**Manhole** Type: **Inline** Location: **Roadway** Ground Conditions: **Wet**

☐ Prev. Rehab Weather: **Dry** Subject To Ponding: **None**

Comments **The I5 pipe is broken inside. The O12 pipe picture shows Channel deterioration.**

**Cover** Shape: **Circular** Diameter: **30** (in.) Length: (in.) Dist A/B Grade: **0** (in.)

Type: **Sanitary** Condition: **Sound** Cover Material: **Cast Iron**

Properties: ☐ Bolted ☐ Vented ☐ Water Tight ☐ Water Tight Insert

**Frame** Offset: **8** (in.) Condition: ☒ Sound ☐ Cracked ☐ Leaks

**Chimney / Frame Adjustment** ☒ Exists Material: **Brick** ☐ Parged Height: **15** (in.)

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☐ None ☒ **Joint** ☐ Cracks ☒ **Mortar** ☐ Roots ☐ Wall

**Corbel** Material: **Brick** ☐ Parged Type: **Concentric/Eccentric**

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☐ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☒ **Wall**

**Barrel** Material: **Brick and Concrete** ☐ Parged

Shape: **D-Shape** Diameter: **48** (in.) Length: **48** (in.)

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☐ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☒ **Wall**

**Bench** ☒ Exists Material: **Brick** ☐ Parged ☒ **Debris** (not Condition related)

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Deteriorated ☐ Leaks ☐ Debris

**Channel** Material: **Brick** ☐ Parged ☐ Debris (not Condition related)

Channel Exposure: **Fully Open** Junc Dist: **0** nearest .5 ft. Azimuth:

Condition: ☐ Sound ☐ Cracked ☐ Root Intrusion ☒ **Deteriorated** ☐ Leaks ☐ Debris

**Steps** Count: **5** Missing: **0** ☒ **Corroded**

**Surcharge** ☒ **Evidence Of Surcharge** Depth: **6** (ft.) ☐ Active Surcharge Present

# Manhole Inspection Summary

Manhole # S13OO1008MH

Printed On: 12/17/2008

Page 2 of 4

Location View




Top View



Evidence of surcharge - Bench debris.  
Corroded steps.

Inside of the I5

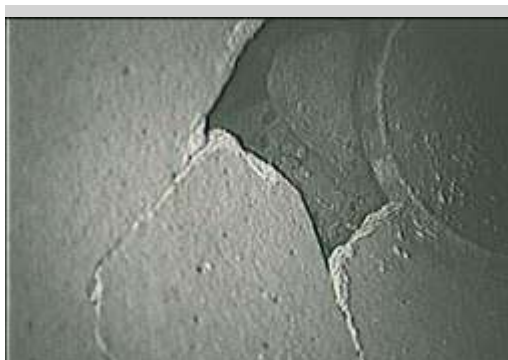

Broken pipe.

Defect



Adjustment and Corbel infiltration.

## Manhole Inspection Summary

Manhole # S13OO1008MH

Printed On: 12/17/2008

Page 3 of 4

### 8 in. Circular Gravity Sewer Pipe Out @ 12 O'Clock



Rod and Bar (Angled)

Pipe Material: **Clay** ☐ Pipe Lined

Invert Depth: **12.10** (ft.) Flow Characteristics: **Fast**

Deposits: ☒ None ☐ Mud ☐ Sludge ☐ Debris ☐ Grease

Silt Depth: (in.) Deposits Extent:

Infiltration: **Evidence** Pipe Seal Cond: **Unknown**

Drop: **None**

Connects To: **Manhole**

☐ Possible Illicit Connection

### 8 in. Circular Gravity Sewer Pipe In @ 2 O'Clock



Rod and Bar (Angled)

Pipe Material: **PVC** ☐ Pipe Lined

Invert Depth: **9.20** (ft.) Flow Characteristics: **None**

Deposits: ☒ None ☐ Mud ☐ Sludge ☐ Debris ☐ Grease

Silt Depth: (in.) Deposits Extent:

Infiltration: **None** Pipe Seal Cond: **Cracked**

Drop: **None**

Connects To: **Dead End**

☐ Possible Illicit Connection

## Manhole Inspection Summary

Manhole # S13OO1008MH

Printed On: 12/17/2008

Page 4 of 4

### 6 in. Circular Gravity Sewer

Pipe In @ 4 O'Clock



Rod and Bar (Angled)

Pipe Material: **DIP/CI** ☐ Pipe Lined

Invert Depth: **11.30** (ft.) Flow Characteristics: **None**

Deposits: ☒ None ☐ Mud ☐ Sludge ☐ Debris ☐ Grease

Silt Depth: (in.) Deposits Extent:

Infiltration: **Evidence** Pipe Seal Cond: **Unknown**

Drop: **None**

Connects To: **House connection / Service line**

☐ Possible Illicit Connection

### 8 in. Circular Gravity Sewer

Pipe In @ 5 O'Clock



Rod and Bar (Angled)

Pipe Material: **Clay** ☐ Pipe Lined

Invert Depth: **7.18** (ft.) Flow Characteristics: **Fast**

Deposits: ☒ None ☐ Mud ☐ Sludge ☐ Debris ☐ Grease

Silt Depth: (in.) Deposits Extent:

Infiltration: **Evidence** Pipe Seal Cond: **Cracked**

Drop In @ 5 O'Clock



Drop: **Outside** Rod and Bar  
Angled: **Yes** Reading: **10.48** (ft.)  
Inv Depth: **11.48** (ft.)

Drop Condition: **Open**

Connects To: **Manhole**

☐ Possible Illicit Connection